


NPE5050 telnet

2010-08-28

2010-08-28	

NPE50

 .山



无法 ， 用户上网访问业务慢

故障现场



```
interface gigabitEthernet 0/0
```

```
description Connect_to_WangTong  --
```

```
interface gigabitEthernet 0/1
```

```
description Connect_to_Ntd1000_LAN3  --      NTD
```

 
```
!
```

 
```
interface gigabitEthernet 0/2
```

```
description Connect_to_Rg8606_1/12-YangPu-OUTPUT
!  
interface gigabitEthernet 1/0
```

```
description UL-JiaoYu  
!  
interface gigabitEthernet 1/1
```


```
description Connect_to_RG8606-G1/5-XiaoBenBu-OUTPUT
```





10.3 4 Release 52974

 cpu 90% telnet山



现场检查

CPU

CPU 90%

Show arp

CPU telnet

NFPP



22	0%	0%	0%	Ttcptimer
23	0%	0%	0%	ip6_tunnel_rcv_pkt
24	0%	0%	0%	ipmrfd
25	0%	0%	0%	tRefRes
26	0%	0%	0%	imid
27	0%	0%	0%	nsmd
28	0%	0%	0%	ripd
29	0%	0%	0%	ospfd
30	0%	0%	0%	bgpd
31	0%	0%	0%	pimd
32	0%	0%	0%	pdmd
33	0%	0%	0%	vaccess
34	0%	0%	0%	PPTP
35	0%	0%	0%	L2TPD
36	0%	0%	0%	L2TP_T
37	0%	0%	0%	vtty_connect

Tnet CPU 1 79% 1 71% 5 68%

Tnet CPU CPU CPU CPU CPU

 
NFPP CPU telnet CPU CPU

show arp
NPE

arp

CPU

<Incomplete>
山








执行


NFPP


山

      
show interface











nat
cpu 山 CPU nat
q telnet

